



SERVICE BULLETIN

Classification: EL04-018	Reference: NTB04-138	Date: December 10, 2004
-----------------------------	-------------------------	----------------------------

2004 ARMADA AND TITAN; “AUTO UP” POWER WINDOW INOPERATIVE

APPLIED VEHICLES: 2004 Armada (TA60)
2004 Titan (A60)

IF YOU CONFIRM:

Either of the Front Door Power Windows:

- Will not go UP when using the “AUTO UP” feature,
- Otherwise operate normally.

NOTE: This incident, if it occurs, may be intermittent.

ACTIONS:

- Replace both the driver's-side and the passenger's-side Front Door Power Window Switch units.
- Use the parts listed in the Parts Information section of this bulletin.
- Refer to Section “EI” DOOR FINISHER Removal and Installation in the appropriate Electronic Service Manual, if needed.

CLAIMS INFORMATION

Submit a Primary Failed Part (PP) line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
RPL Power Window Main Switch (LH)	(1)	RK10AA	ZE	32	(2)
RPL Front Power Window Sub Switch (RH)		RK12AA			(2)

1. Reference the Parts Information table, and use the indicated Driver’s Side Switch Unit P/N as the PFP.
2. Reference the current Nissan Warranty Flat Rate Manual and use the indicated FRT.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
Driver's Side SW Unit – Power Window Main (Armada, Titan Crew Cab)	25401-7S201	1
Driver's Side SW Unit – Power Window Main (Titan King Cab)	25401-7S213	1
Passenger's Side SW Unit – Power Window Asst	25411-7S201	1

