



SERVICE BULLETIN

Classification: EL04-002	Reference: NTB04-010	Date: January 21, 2004
-----------------------------	-------------------------	---------------------------

BODY CONTROL MODULE (BCM) CONFIGURATION SETTING AFTER REPLACEMENT

APPLIED VEHICLES: All 2004 Titan (A60)
All 2004 Pathfinder Armada (TA60)

SERVICE INFORMATION

If, for any reason, you have to replace the BCM in an applied vehicle, please note that the H/L Bulb configuration (for the new BCM) must be set to **“HID”**. It doesn't matter if the vehicle is equipped with Halogen or Xenon headlamps.

- You'll have to use CONSULT-II to do this task
- The current Electronic Service Manual (ESM) will be updated with the latest procedure and released in March 2004
- Until March, refer to the Service Manual Amendment titled **“2004 Titan/Armada; BCM Configuration for Headlamp Bulb (H/L Bulb)”** for the latest procedure

NOTE: To view the Service Manual Amendment in ASIST:

- click on **“INFO. Tool Box”**
- click on **“SM Amendments”**
- select **“Model”** and **“Model Year”**

BCM CONFIGURATION SETTING FOR H/L BULB (AFTER BCM REPLACEMENT)

READ CONFIGURATION	
KEYLESS ENTRY	WITH
H/L BULB	HALOGEN
AUDIO LIGHT	WITH
FR FOG LAMP	WITH
DTRL	WITHOUT
REAR WIPER	WITH

No

READ CONFIGURATION	
KEYLESS ENTRY	WITH
H/L BULB	HID
AUDIO LIGHT	WITH
FR FOG LAMP	WITH
DTRL	WITHOUT
REAR WIPER	WITH

Yes

TP040002