



SERVICE BULLETIN

Classification: EL03-048b	Reference: NTB04-001b	Date: February 4, 2005
------------------------------	--------------------------	---------------------------

REMOTE KEYLESS ENTRY REPLACEMENT PARTS

- APPLIED VEHICLES:**
- 2002 - 2003 Maxima (A33)
 - 2002 - 2004 Pathfinder (R50)
 - 2003 - 2004 350Z (Z33)
 - 2004- 2005 Quest (V42)
 - 2004- 2005 Titan (A60)
 - 2004- 2005 Armada (TA60)
 - 2002- 2005 Altima (L31)
 - 2004 Maxima (A34)
 - 2003 - 2004 Murano (Z50) - vehicles without Intelligent Key

This bulletin contains amended Parts Information and Applied Vehicles sections. Please discard all previous copies of NTB04-001a.

IF YOU CONFIRM:

The Remote Keyless Entry keyfob of an Applied Vehicle needs to be replaced for any reason.

ACTIONS:

The keyfob is now available as 2 separate service parts: the cover (outer shell), and the print board assembly (inner circuit board).

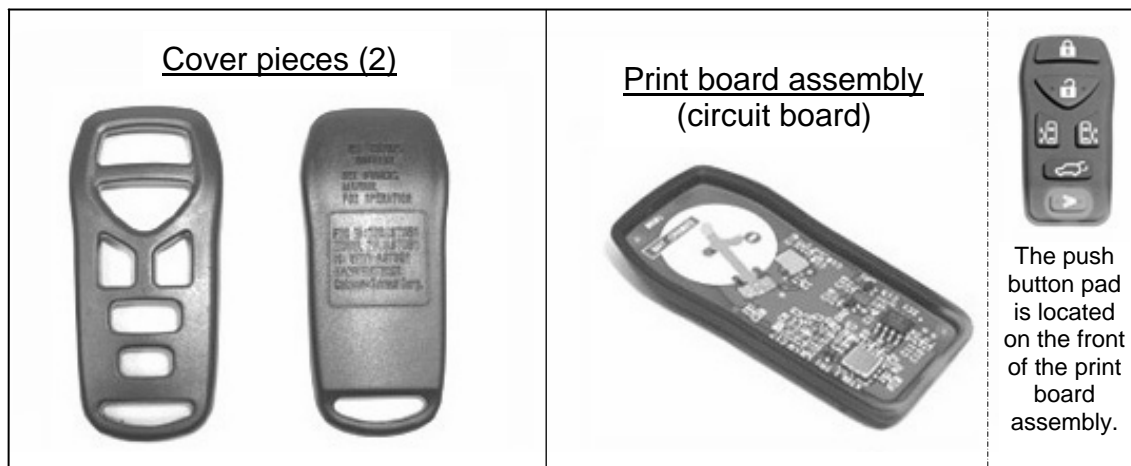


Figure 1

IMPORTANT: The purpose of "ACTIONS" (above) is to give you a quick idea of the work you will be performing. If Reprogramming is needed, you **MUST** closely follow the entire Service Procedure (starting on page 2) as it contains information that is essential to successfully completing the repair.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, **DO NOT** assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

- Refer to the Parts Information table below, for the part you need, as applicable.
- Refer to the Diagnostic Procedure on page 3 for assistance in determining which parts should be replaced.

PARTS INFORMATION

Vehicle	MY	Cover, Remote Keyless	Print Board Assy, Remote Keyless	Note
Maxima	2002 - 2003	285A0 5Y701	285A1 5Y701	
	2004	285A0 8J000	285A1 8J000	
Pathfinder	2002 - 2004	285A0 5W501	285A1 5W501	
350Z	2003 - 2004	285A0 5Y701	285A1 5Y701	
Murano	2003 - 2005	285A0 5W501	285A1 5W501	Not Intelligent Key
Quest	2004-2005	285A0 7Z800	285A1 7Z800	3 button
	2004-2005	285A0 5Z210	285A1 5Z210	5 button
	2004-2005	285A0 5Z200	285A1 5Z200	6 button
Titan	2004-2005	285A0 7Z800	285A1 7Z800	
Armada	2004-2005	285A0 7Z800	285A1 7Z800	3 button
	2004-2005	285A0 8J000	285A1 8S200	4 button
Altima	2002-2005	285A0 8J000	285A1 8J000	

Remote Keyless Entry Replacement Parts - Diagnostic Procedure

