



# SERVICE BULLETIN

Classification:

HA05-005

Reference:

NTB05-096

Date:

October 24, 2005

## 2004 – 2005 TITAN AND ARMADA; RATTLE FROM CONDENSER FAN MOUNT

**APPLIED VEHICLES:** 2004 – 2005 Titan (A60)  
2004 – 2005 Armada (TA60)

### IF YOU CONFIRM

- The customer reports there is a rattle noise coming from the engine compartment,
- AND**
- The fan assembly has looseness or play at the lower mounting tabs.

### ACTIONS

1. Remove the condenser fan and apply felt cloth tape to the lower mounting tabs (see Figure 1, also Figure 2 on the next page).
  - Refer to section CO in the Electronic Service Manual (ESM) for condenser fan (Engine Cooling Fan) removal and installation information.
2. Reinstall the fan using the new attachment bolt listed in the Parts Information.
  - When reinstalling the fan, make sure it's adjusted to the full down position.
  - Make sure the fan assembly does not have looseness or play at the lower mounting tabs.
3. Test drive the vehicle and make sure the rattle is gone.

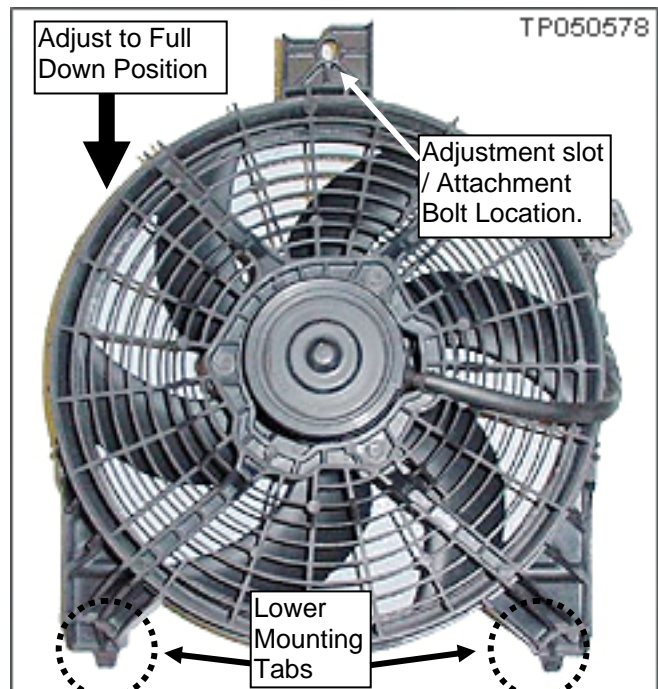


Figure 1

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

Felt cloth tape applied to lower mounting tab of condenser fan.



Figure 2

## PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
New Attachment Bolt for Condenser Fan	01121-0039U	1
Felt Cloth Tape (1)	68239-13E00	as needed

(1) Felt-Cloth Tape can be found in the Squeak and Rattle Kit—J-43980. Refill items in the kit by ordering from your NNA PDC. Additional Squeak and Rattle Kits can be ordered from Tech-Mate at 1-800-662-2001—option 1.

## CLAIMS INFORMATION

Submit a Primary Failed Part (PP) line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
R&I Condenser Fan (Install Felt Cloth Tape)	(1)	TD32AA	ZL	46	(2)

(1) Reference the FAST Parts Catalog and use the applicable Condenser Fan P/N as the PFP.

(2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated FRT.